

This article was downloaded by: [CDC Public Health Library & Information Center]

On: 15 May 2014, At: 12:55

Publisher: Taylor & Francis

Informa Ltd Registered in England and Wales Registered Number: 1072954 Registered office: Mortimer House, 37-41 Mortimer Street, London W1T 3JH, UK



## Applied Occupational and Environmental Hygiene

Publication details, including instructions for authors and subscription information:

<http://www.tandfonline.com/loi/uaoh20>

### Control of Scrap Paper Baler Crushing Hazards

Published online: 30 Nov 2010.

To cite this article: (2000) Control of Scrap Paper Baler Crushing Hazards, Applied Occupational and Environmental Hygiene, 15:5, 397-399, DOI: [10.1080/104732200301322](https://doi.org/10.1080/104732200301322)

To link to this article: <http://dx.doi.org/10.1080/104732200301322>

PLEASE SCROLL DOWN FOR ARTICLE

Taylor & Francis makes every effort to ensure the accuracy of all the information (the "Content") contained in the publications on our platform. However, Taylor & Francis, our agents, and our licensors make no representations or warranties whatsoever as to the accuracy, completeness, or suitability for any purpose of the Content. Any opinions and views expressed in this publication are the opinions and views of the authors, and are not the views of or endorsed by Taylor & Francis. The accuracy of the Content should not be relied upon and should be independently verified with primary sources of information. Taylor and Francis shall not be liable for any losses, actions, claims, proceedings, demands, costs, expenses, damages, and other liabilities whatsoever or howsoever caused arising directly or indirectly in connection with, in relation to or arising out of the use of the Content.

This article may be used for research, teaching, and private study purposes. Any substantial or systematic reproduction, redistribution, reselling, loan, sub-licensing, systematic supply, or distribution in any form to anyone is expressly forbidden. Terms & Conditions of access and use can be found at <http://www.tandfonline.com/page/terms-and-conditions>

## Hazard Controls

# Control of Scrap Paper Baler Crushing Hazards

From the National Institute for Occupational Safety and Health

### Definition of Hazard

Personnel who load, operate, or maintain balers can be exposed to crushing and amputation hazards if the baler is inadequately safeguarded, or if hazardous energy lockout procedures are not followed. Serious injuries and fatalities have occurred when parts of the worker's body was caught by the baler ram inside loading and baling chambers. In 1995, a National Institute for Occupational Safety and Health (NIOSH) field study found that some balers *do not* meet the safeguarding requirements listed in the voluntary ANSI Z245.5-1990 Standard.

### Description of Controls

An amendment to the Fair Labor Standards Act, the principal law governing the employment of children under 18 years of age, became effective August 6, 1996. The amendment allows 16- and 17-year-olds, under certain conditions, to load material into, but not operate or maintain balers. However, the recommendations contained in this document are applicable to adult workers only.

Checklists that highlight the ANSI and OSHA standards are included on the following pages, with particular emphasis on the commonly-used vertical downstroke baler (see Figure 1). Users should review these checklists for safe baler operation. Based on its research, NIOSH recommends three criteria be satisfied to protect workers from injury during operation of paper balers:

- The point-of-operation guarding, such as an interlock gate, must prevent workers from placing any parts of their body

into the hazardous areas of the paper baler during operation.

- Periodic inspection and maintenance of the equipment and safeguarding devices must be conducted to ensure proper operation and safe performance.
- Workers must be trained in safe operation of the equipment, understand the hazards related to bypassing safety devices, and recognize the limitations and effective operating ranges of safety devices.

### ANSI Standard

The American National Standards Institute's "Baling Equipment-Safety Requirements" (ANSIZ245.5-1990) sets forth several requirements for "safety interlocks" and "safe lockout procedures" to stop or prevent hazardous motion of the baler's ram when open gates or ac-

cess doors permit a person's hands, arms, or body to be in the path of the ram (see Figure 2).

### OSHA Standard

The OSHA standard (29 CFR 1910.147) has established minimum performance requirements for the control of hazardous energy. Six steps must occur, in the following sequence, prior to service or maintenance on a baler:

1. Preparation for shutdown: The authorized employee must know the type and magnitude of energy, hazards of the energy, and method or means to control the energy.
2. Shutdown: The baler shall be shutdown using orderly and established procedures.
3. Isolation: Electrical circuit interrupters or similar devices shall isolate the baler from the energy source.

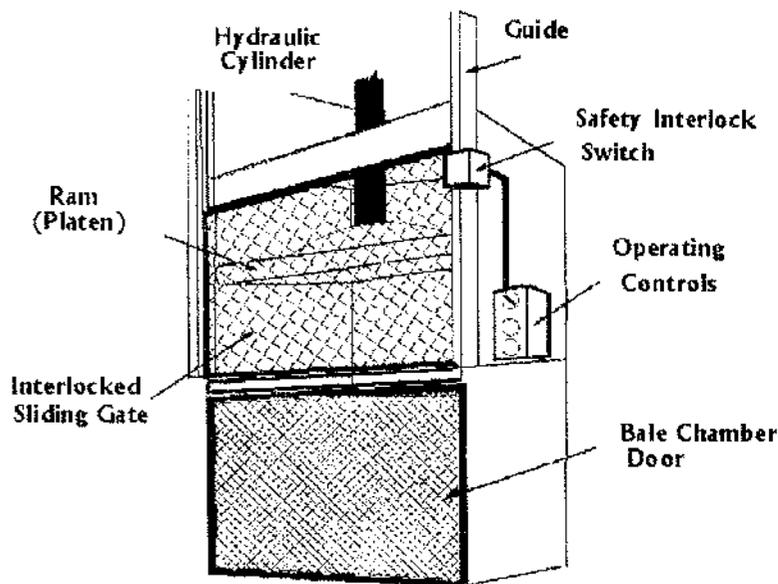
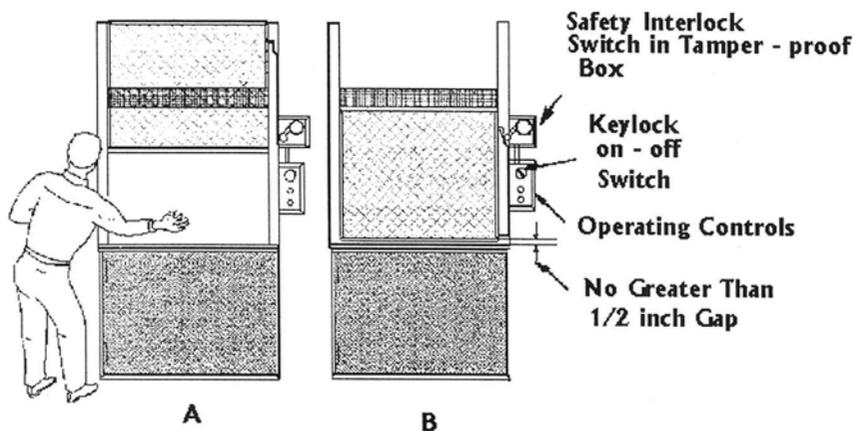


FIGURE 1  
Vertical downstroke baler: Basic components.

Requirements	Important Considerations
<b>All Balers</b>	
<p>Access covers, access doors, and protective shields shall be safely secured.</p> <p>Maintenance personnel are trained to follow manufacturer's recommended procedures for balers that the employer maintains.</p> <p>The manufacturer's tag indicates that the baler was constructed in accordance with ANSI Z245.5.</p> <p>There is a lockable power disconnect and an effective lockout procedure.</p> <p>A lockout procedure is written specific to that baler.</p>	<p>If access doors are lockable, the key should be kept by an authorized person. By location or design, interlock components should not be easy to tamper with.</p> <p>16- and 17-year olds are allowed only to load balers and shall not operate or perform maintenance, including clearing jams from the machine.</p> <p>This indicates that the chamber door and latch have been designed to withstand the maximum ram forces on the material being baled.</p> <p>A clear line of sight from the baler to the disconnect avoids unexpected start-ups.</p> <p>Lockout is required for cleaning, jam clearing, and maintenance. Lockout procedures that must meet OSHA requirements are listed on page 4.</p>
<b>Vertical Downstroke Balers</b>	
<p>The ram will not function unless the bale chamber door is closed and latched, except when operated with a control that must be kept engaged by the operator.</p> <p>The loading chamber door or gate must completely cover the loading chamber before the ram can be activated and must remain closed during the compression stroke. The ram must stop or return to rest if the door or gate is opened more than 1/2 inch during the compression stroke.</p> <p>The protective gate cannot be opened faster than the ram rises to keep the top of the ram protected during the upstroke.</p> <p>Manufacturer's instructions must include provisions for manually installing a blocking device, which will restrain inadvertent downward motion of the ram whenever workers must enter the baling chamber.</p>	<p>Bale unloading is accomplished by upward ram motion, so a maintained-contact control (such as a push button) is appropriate.</p> <p>If the gate is opened more than 1/2 inch during the compression stroke, and ram movement continues, then the gate interlock is not functioning properly and needs to be repaired.</p> <p>A safe procedure for clearing scrap from the top of the ram should include locking out power.</p> <p>In addition to proper isolation and control of electrical energy during maintenance, the potential energy of the ram must be controlled by a blocking device of sufficient strength to resist downward ram motion.</p>



**FIGURE 2**

Sample interlocked sliding gate: Two gate positions are shown: (A) open for loading (potentially hazardous) and (B) closed for operating (safe). The safety interlock switch opens and closes electrical contacts that control power to the baler ram depending on the position of the gate. Tampering, misadjustment, or wear of the safety interlock switch can allow the gate opening to exceed 1/2 inch (maximum). Note that the baler shown also has a key-locked power control that prevents baler operation when the key is removed and kept by an authorized person. (Illustrator: Daniel S. Watkins.)

4. Lockout/tagout device application: Lockout devices shall be affixed to each energy-isolating device by authorized employees unless tagout devices can be demonstrated to provide full protection.
5. Energy due to gravity or hydraulic pressure: All potentially hazardous stored energy shall be relieved, disconnected, restrained, or otherwise rendered safe.
6. Verification of isolation: Prior to working on the baler, the authorized employee must verify that

the baler has been isolated and deenergized.

Two steps must occur prior to baler operation:

1. No human exposure: Verify that no one is in the path of ram motion.
2. Power on: Remove lockout devices and operate controls to restore power.

#### **For More Information**

To obtain a free copy of the NIOSH Report—Review of Safeguarding Tech-

nology Used on Paper Balers (1995), or for information on other occupational safety and health issues, call NIOSH at 1-800-35-**NIOSH** (1-800-356-4674), or visit the NIOSH Home Page on the World Wide Web at <http://www.cdc.gov/niosh/homepage.html>

#### **Acknowledgments**

The principal contributors to this Hazard Controls are John R. Etherton, Cheryl F. Estill, G. Scott Earnest, and Jerome P. Flesch, NIOSH. This Hazard Controls is DHHS (NIOSH) Publication No. 97-113.